

**S-TYPE**

DATE 02/03

S307-10

**SERVICE****TECHNICAL BULLETIN**

MIL Illuminated/DTC P0606 –  
Shift Quality/Driveability Issues – ZF 6HP24 –  
Reprogram TCM

MODEL 2003 MY  
S-TYPE  
VIN M44998-M81000

**Issue:**

Owners of some 2003 MY S-TYPE vehicles, within the above VIN range, may experience the following issues:

- Transmission Malfunction Indicator Lamp (MIL) illuminating and Diagnostic Trouble Code (DTC) P0606 logged.
- Transmission hesitating and then thumping into gear from 2 – 1.
- Transmission judder in second gear.

To eliminate these issues, the Transmission Control Module (TCM) should be reprogrammed using the Worldwide Diagnostic System (WDS) with software release JTP 759/23 or later.

**Action:**

In case of a verified customer complaint of the above issues on a 2003 MY S-TYPE within the above VIN range, reprogram the Transmission Control Module (TCM) using the WDS with software release JTP 759/23 or later.

**REPROGRAMMING PROCEDURE**

**Note:** Ensure WDS is loaded with software release JTP 759/23 or later.

1. Position WDS alongside vehicle, switch Portable Test Unit (PTU) 'ON' and allow software to load.
2. Connect PTU to the vehicle's DLC using the diagnostic cable.
3. Enter VIN and navigate to configuration main menu.
4. Select and run 're-configure existing TCM' application.
5. After re-configuration of TCM is complete, switch 'OFF' PTU, disconnect from vehicle and return WDS to original location.

**Warranty Information:**

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

| Description     | SRO      | Time     | Causal Part Number | Causal Part Description |
|-----------------|----------|----------|--------------------|-------------------------|
| Reconfigure TCM | 86.99.10 | 0.3 hrs. | C2C 6718           |                         |