



S-TYPE

DATE 08/05

S501-29

SERVICE

TECHNICAL BULLETIN

Interior Mirror Compass – Compass Reading Incorrectly – Reroute Wiring

MODEL 2000 MY-ON
S-TYPE

VIN L00001-ON

Issue:

Some S-TYPE vehicles equipped with the interior mirror compass may exhibit a condition where the compass is functioning but reading incorrectly.

Cause:

Interference from nearby wiring.

Action:

In case of a customer complaint of incorrect compass indication, reroute the interior mirror wiring as outlined below.

1. Remove the auto-dimming interior mirror (see Global Technical Reference GTR Workshop Manual, section 501-09).

Note: No wires should cross over the compass circuit board. Each set of wires should be routed as a twisted pair for maximum effect.

2. Reroute the wires around the edge of the plastic casing.
3. Install the auto-dimming interior mirror (see Global Technical Reference GTR Workshop Manual, section 501-09).

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Re-route interior mirror wiring	86.93.58	0.2 hrs.	C2C 23847

Note: Repair procedures are under constant review, and therefore repair times are subject to change. The times quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.