

Part Load Breather Line – Proper Routing

MODEL 1997 MY-ON
XK8 Range
VIN
001001-ON


Issue:

The part load breather line on XK8 vehicles can be damaged if it is not routed properly after servicing the vehicle.

Action:

After performing any work in the engine compartment that may have required disconnecting the part load breather line, observe the following:

- The part load breather line must follow the routing under the intake manifold and along the bulkead wall as indicated in Illustration 1.
- The part load breather line must be attached to the vacuum signal line by the clip.
- The part load breather line must be above and attached to the inner heater hose by the clip.
- The part load breather line must be positioned above the fuel lines.

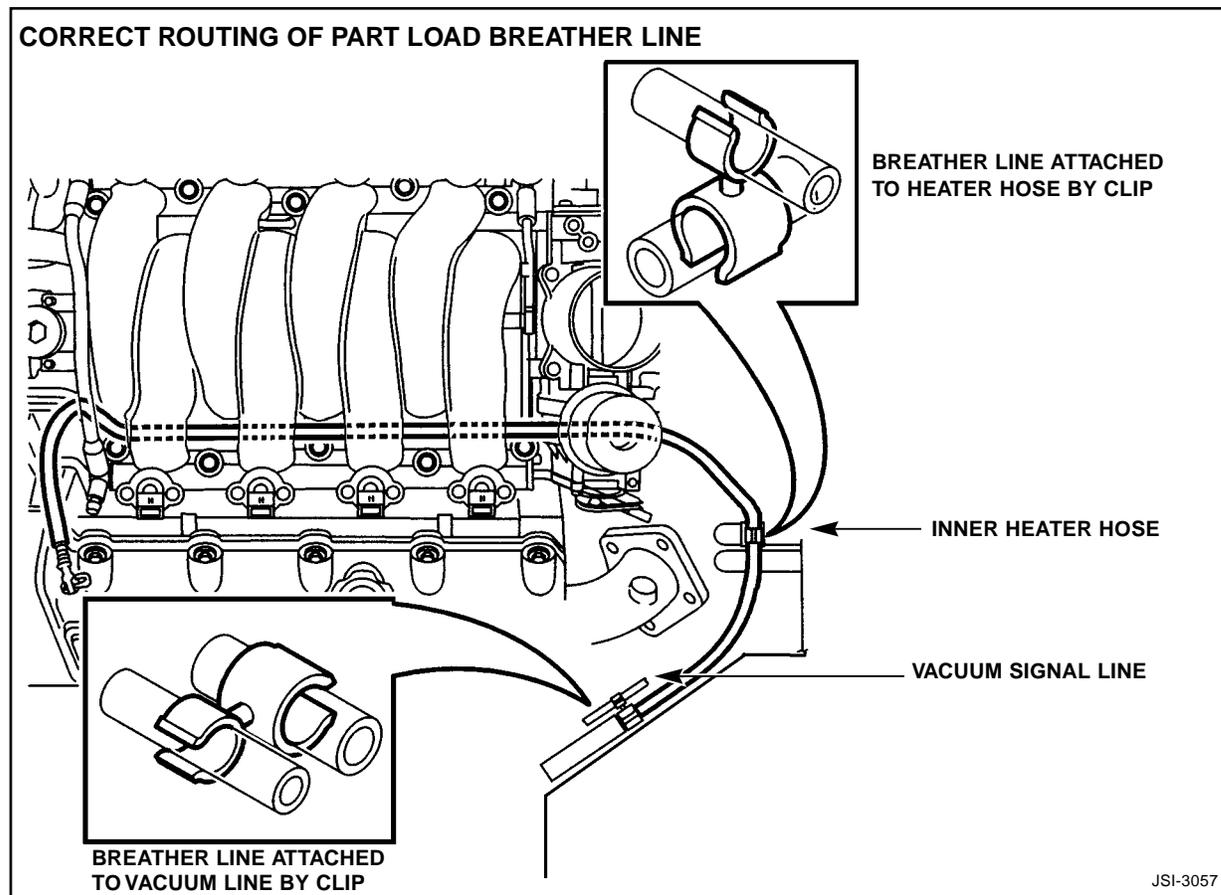

JSI-3057

ILLUSTRATION 1

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Swivel clip - Breather line to vacuum line	KDP 208120	1
Swivel clip - Breather line to heater hose	KDP 212230	1