

**Squeaks & Rattles – Traction Control Cable
– Check Cable Position**

MODEL 1995-96 MY
Sedan Range

VIN

720001-ON

ISSUE:

Some 1995 MY-ON Sedan Range vehicles with traction control may experience a noise coming from the right side of the fascia/bulkhead/under hood area. The noise may be caused by contact between the throttle cable casing and the slot in the right side tool box.

ACTION:

After verifying a customer complaint of noise as described above on a 1995 MY-ON Sedan Range vehicle with traction control, check that the throttle cable is centered in the toolbox assembly slot (Illustration 1).

If the cable is not positioned in the center of the slot, note the position and proceed as described on the next page.

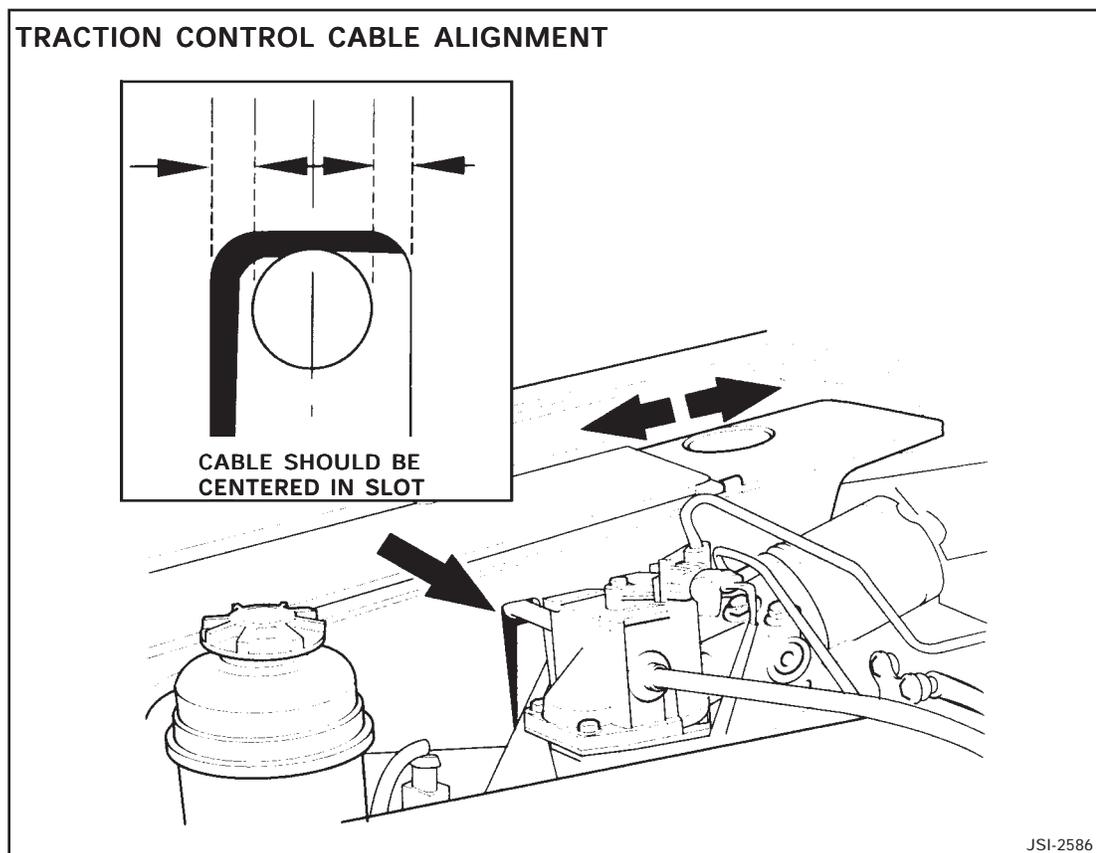


ILLUSTRATION 1

CENTERING THE TRACTION CONTROL THROTTLE CABLE

1. Remove the toolbox assembly.
2. If the cable position requires adjustment, release the cable clip and reposition the cable as needed.
3. Position the toolbox, without securing it, to check that the cable position is correct.
4. After the cable is centered properly as in Illustration 1, secure the toolbox assembly.

WARRANTY INFORMATION:

FAULT CODE	R.O. NUMBER	DESCRIPTION	TIME ALLOWANCE
HG LB MS	76.92.94	Aligning control cable	0.10 hrs.