

## Front Wheel Hub – Accumulation Of Excess Grease – Grease Deflector Ring

**MODEL**

1997 MY-ON XK8 Range

1998 MY-ON V8 Sedan NA

**VIN**

018108-ON

812256-ON

**Issue:**

Vehicles after the above VIN are equipped with a nylon grease deflector ring on the rotor nut of each front hub. This ring prevents the build-up of excess grease near the seal which could collect dirt that could damage the seal.

**Action:**

When performing a repair on a 1997 MY-on XK8 that requires removing the rotor nut, install a grease deflector ring during reassembly. 1998 MY-on vehicles must always have the deflector ring reinstalled during any service to the front hub.

The deflector ring is a light interference fit on the nut and must be installed 0.5 mm from the edge of the hub as shown in Illustration 1.

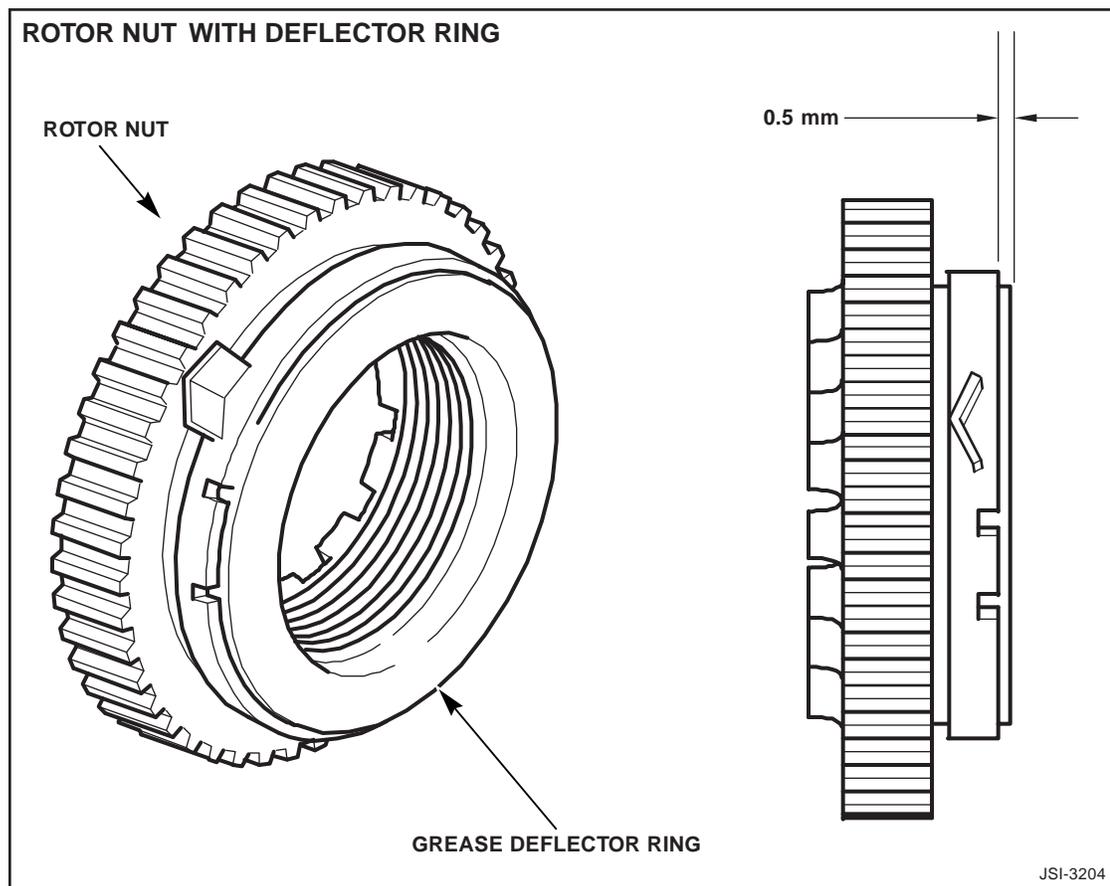


ILLUSTRATION 1

**Parts Information:**

**DESCRIPTION**

Deflector ring

**PART NUMBER**

MJA 1846AA

**QTY**

1