

Fuel Pipe – Rattle –  
Install Pipe Clip

MODEL 1995 MY  
Sedan (4.0l) Range  
VIN  
720001 - 738089

**ISSUE:**

1995 MY Sedan Range vehicles within the VIN range above may experience a light rattle from the rear. The rattle occurs at idle with the vehicle stopped. A plastic fuel pipe clip was installed in production at VIN 738090 to stabilize the fuel pipes and prevent the possibility of a rattle.

**ACTION:**

If a customer complains of a rattle as described above, perform the following procedure.

1. Check the alignment of the fuel feed and return pipes near the fuel filter. The fuel pipes must not come into contact with any body member or adjacent pipes.
2. Install a plastic pipe clip (part number KDG 108104) between the fuel pipes as shown in Illustration 1.

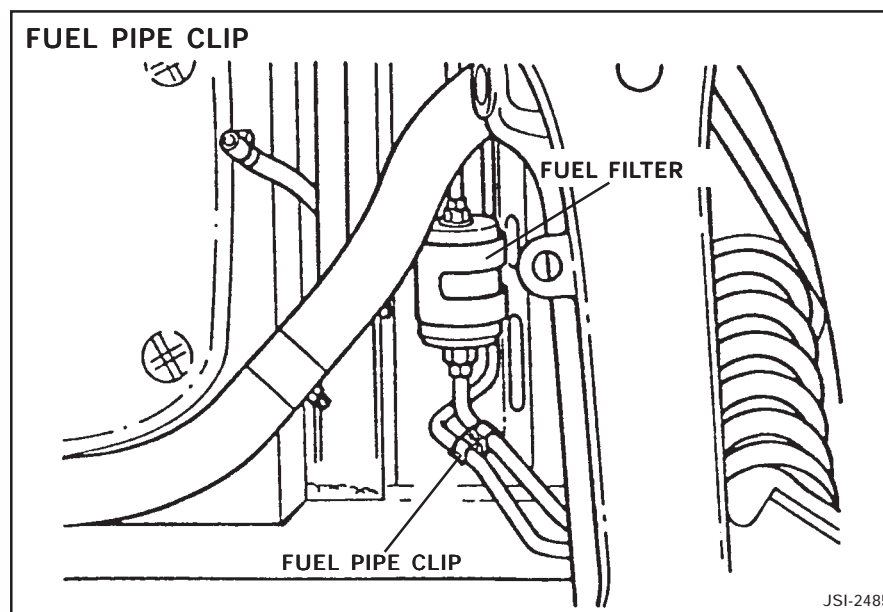


ILLUSTRATION 1

**PARTS INFORMATION:**

**DESCRIPTION**

Plastic Pipe Clip

**PART NUMBER**

KDG 108104

**WARRANTY INFORMATION:**

**FAULT**

**CODE**

CL NB GF

**R.O.**

**NUMBER**

19.91.44

**DESCRIPTION**

Fit fuel pipe clip

**TIME**

**ALLOWANCE**

0.10 hrs.