



XJ range

DATE 03/05

XJ501-14

SERVICE

TECHNICAL BULLETIN

**Unoccupied Front Passenger Seat Noise –
Recliner Mechanism Missing Anti-Rattle Clip –
Repair Procedure**

MODEL 2004 MY-ON
XJ range

VIN G00001-ON

Issue:

This Technical Bulletin has been issued to address customer concerns of a noise from the front passenger seat recliner mechanism.

Cause:

Omission of the anti-rattle clip on the front passenger seat recliner mechanism.

Action:

To install a new anti-rattle clip to the front passenger seat recliner mechanism, follow the Service Instruction outlined below.

Note: Ensure the passenger seat backrest is in the upright position.

1. Remove the front passenger seat (see Global Technical Reference GTR Workshop Manual, section 501-10).
2. Remove the front passenger seat backrest rear cover (see Global Technical Reference GTR Workshop Manual, section 501-10).
3. Displace the front seat backrest cover from both sides of the backrest frame.

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

Working on one side of the seat:

4. Reposition the front seat backrest cover and detach the recliner mechanism tension spring (Illustration 1).

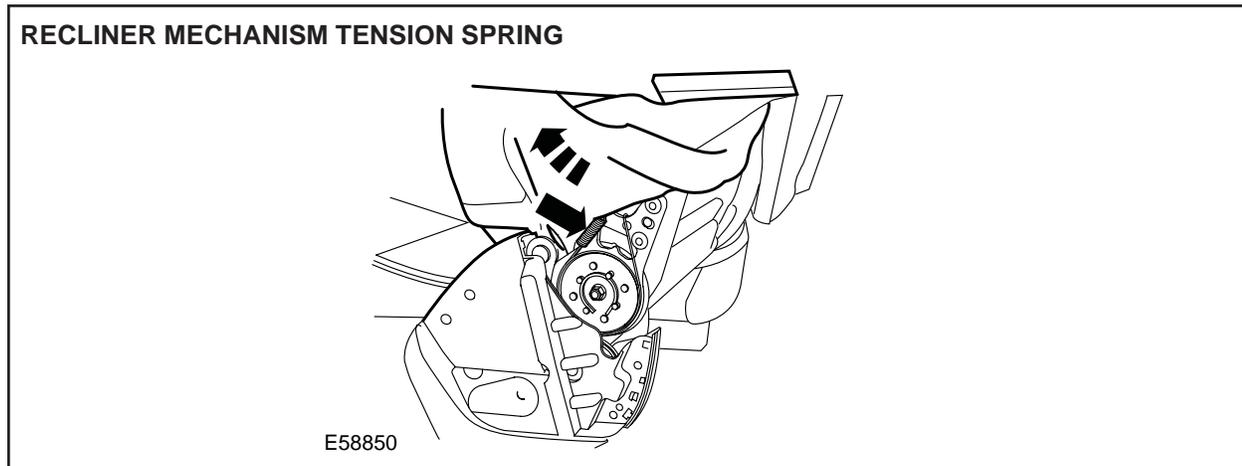


ILLUSTRATION 1

5. Apply suitable grease to the bottom channels of the anti-rattle clip.
6. Place the new anti-rattle clip on the recliner mechanism.
7. Insert the anti-rattle clip in the recliner mechanism (Illustration 2).

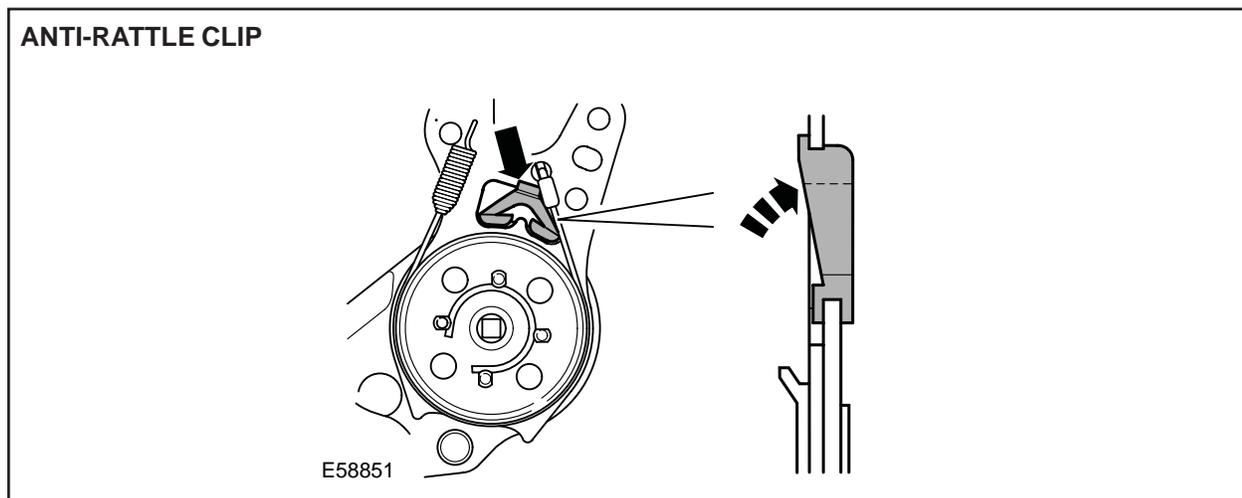


ILLUSTRATION 2

8. Attach the recliner mechanism tension spring.
9. For the opposite side of the seat, repeat steps 4 to 8.
10. Reposition the front seat backrest bolster lower trim into fitted position.
11. Align and install the front seat backrest cover to original condition.
12. Install the front seat backrest rear cover (see Global Technical Reference GTR Workshop Manual, section 501-10).
13. Install the front passenger seat (see Global Technical Reference GTR Workshop Manual, section 501-10).

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Anti-rattle clip	C2C 24734	2
Fir tree clip	XR8 43848	2

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install anti-rattle clips	76.94.88	0.9 hrs.	C2C 24734